

2007 Snowmobile Technical Update

2007 RX10GT, RXW10GT

Ohlins EC Shock Wiring Harness, Routing and Clamping

- On 2007 Ohlins EC models, the solenoid sub-lead harness routing and clamps have been changed to reduce the chance of sub-lead harness damage if the suspension is heavily bottomed.
- Plastic protective boot over the connector is no longer used.
- Solenoid harness routing and clamping changed at the solenoid to prevent the wires from protruding above the solenoid and contacting the track during hard bottoming.
- Sub-lead harness routing and clamping to the suspension arm changed.
- New wider plastic clamp, p/n 90464-35132, to better secure the harness to the suspension arm.

