



**FX NYTRO MTX Models**

- Remove the three push nuts retaining the housing cable onto the tunnel (see Fig. 9).
- Position and fasten the right upper part of the gas caddy (#1) onto the tunnel using the M8x20mm Allen socket machine screw (#11), the 5/16" DIA flat washer (#16), and the M8 nylock nut (#15) (finger tighten only at this time) (see Fig. 10).
- Using the gas caddy (#1) as a template and drill the upper mounting hole with a 5/16" DIA drill bit. Drill the two lateral mounting holes with a 7/32" DIA drill bit (see Fig. 11).
- Fasten the left upper part of the gas caddy (#1) onto the tunnel using the M8x20mm Allen socket machine screw (#11), the 5/16" DIA flat washer (#16), and the M8 nylock nut (#15) (see Fig. 12).
- Fasten the lower part of the gas caddy (#1) onto the tunnel side using (2) M5x25mm Allen socket machine screws (#10), (2) grommets (#19), and (2) M5 nylock nuts (#14). Tighten all machine screws and nuts (see Fig. 12).

